

# ZyXEL GS-4024 V3.70(LL.0)C0

## Release Note/Manual Supplement

**Date: Sep. 28, 2006**

This document describes the features in the GS-4024 product for its 3.70(LL.0)C0 release.

### **Support Platforms:**

ZyXEL GS-4024 V3.70(LL.0)C0 supports models: Dimension GS-4024

### **Version:**

ZyNOS version: V3.70(LL.0) | 09/28/2006 16:01:48

bootbase version: V3.0 | 04/06/2005 18:05:30

### **Default Bootbase Setting:**

ZyNOS Version	V3.70(LL.0)   09/28/2006 16:01:48
Bootbase Version	V3.0   04/06/2005 18:05:30
Vendor Name	ZyXEL Communications Corp.
Product Model	GS-4024
ZyNOS Code Model	GS-4024
HTP Code Model	Unknown
ZyNOS ROM address	50080000
System Type	10
MAC Address	001349000001
Default Country Code	FF
Boot Module Debug Flag	00
RomFile Version	5A
RomFile Checksum	67ef
ZyNOS Checksum	d824
SNMP MIB level & OID	060102030405060708091011121314151617181920
Main Feature Bits	C0
Other Feature Bits	
DB 00 00 00 00 00 00 00 00 00-00 00 00 00 00 00 00 00	
00 00 00 00 00 00 00 00 00-00 4113 00 00 00	

### **Enhanced Feature**

1. Syslog
2. Multiple RSTP
3. Multicast routing on MVR
4. RADIUS enhancement(for 802.1X enhancement and multiple radius servers)
5. Administration user management
6. IGMP enhancement
7. Web enhancement (Select all, Clone)
8. Reserve multicast group support
9. OSPF enhancement (passive interface and interface priority)

### ***Known Issue:***

---

1. In some circumstances, packets may route to blocking port of the other device when use Spanning Tree Protocol for redundant purpose between two devices. Recommend using Link Aggregation instead.
2. For many to one test , packet loss 3 % on one receiving port.
3. Discard destination MAC on filter rule , but the same source MAC packet still be filtered.
4. Can't support ip port move.
5. Flow control can not go across unit.

### ***Bug Fix:***

---

1. none

### ***Limitation of Settings:***

---

1. VLAN 1Q static entry 256
2. Static MAC forwarding entry 256
3. MAC filtering entry 256
4. Cluster member 24
5. IP routing domain 64
6. IGMP Filtering entry 256
7. MVR entry 256
8. Vrrp entry 14
9. OSPF area 4
10. DHCP Server 16
11. Syslog server entry 4

### ***Change History:***

---

#### **V3.70(LL.0)C0 (9/18/2006)**

Support new features

#### **V3.60(LL.3)C0 (5/3/2006)**

1. Change temperature  
MAC: 75 ~ -10, CPU: 65 ~ -10, PHY: 75 ~ -10

#### **V3.60(LL.2)C0 (1/2/2006)**

1. Restore config with IP address fail because out-of-band and inband exchange IP addresses.
2. Remove "time" and "time date" in backup configuration
3. Timesync config can't restore
4. Enable OSPF , send over 8K routing paths, system hang.
5. DUT trap VRRP packets into CPU when VRRP disable
6. Create more than 6 static routing entries, the switch will hang
7. The Vlan status does not recover to original status after change trunking group to none.
8. Create VLAN ID 000001 via CLI found VLAN ID 0 is be created
9. Enable IGMPsnooping, One port leave message effect on another received port losing multicast packets, it should not effect on another received port.
10. revise ospf interface web page
11. Can't use Cluster Management function with Telnet or SSH client to re-command members.
12. In filtering function set Filter Destination after SMB send unknow unicast CLI will show "sal\_dma\_alloc out of memory. size 9232 packet\_alloc. "
13. DUT 's RIPv2 multicast function did not work
14. Memory leak bug on stunnel. It will run out of memory when scan https many times.
15. When fiber set to speed 1000, auto negotiation should be turn off.

#### **V3.60(LL.1)C0 (6/27/2005)**

#### **V3.60(LL.0)C0 (3/24/2005)**

First Public version

# ZyXEL GS-4024 V3.60(LL.3)C0

## Release Note/Manual Supplement

---

**Date:** May. 3, 2006

This document describes the features in the GS-4024 product for its 3.60(LL.3)C0 release.

### **Support Platforms:**

---

ZyXEL GS-4024 V3.60(LL.3)C0 supports models: Dimension GS-4024

### **Version:**

---

ZyNOS version: V3.60(LL.3) | 05/03/2006 17:54:22  
bootbase version: V3.0 | 04/06/2005 18:05:30

### **Default Bootbase Setting:**

---

ZyNOS Version	V3.60(LL.3)   05/03/2006 17:54:22
Bootbase Version	V3.0   04/06/2005 18:05:30
Vendor Name	ZyXEL Communications Corp.
Product Model	GS-4024
ZyNOS Code Model	GS-4024
HTP Code Model	Unknown
ZyNOS ROM address	50080000
System Type	10
MAC Address	001349000001
Default Country Code	FF
Boot Module Debug Flag	00
RomFile Version	5A
RomFile Checksum	67ef
ZyNOS Checksum	864d
SNMP MIB level & OID	060102030405060708091011121314151617181920
Main Feature Bits	C0
Other Feature Bits	
DB 00 00 00 00 00 00 00 00 00-00 00 00 00 00 00 00 00 00 00 00 00 00 00 00 00 00-00 4113 00 00 00	

### **Enhanced Feature**

- 
10. Change temperature  
MAC: 75 ~ -10, CPU: 65 ~ -10, PHY: 75 ~ -10

### ***Known Issue:***

---

2. In some circumstances, packets may route to blocking port of the other device when use Spanning Tree Protocol for redundant purpose between two devices. Recommend using Link Aggregation instead.
3. For many to one test , packet loss 3 % on one receiving port.
4. Discard destination MAC on filter rule , but the same source MAC packet still be filtered.
5. Can't support ip port move.
6. Flow control can not go across unit.

### ***Limitation of Settings:***

---

12. VLAN 1Q static entry 256
13. Static MAC forwarding entry 256
14. MAC filtering entry 256
15. Cluster member 24
16. IP routing domain 64
17. IGMP Filtering entry 256
18. MVR entry 256
19. Vrrp entry 14
20. OSPF area 4

### ***Change History:***

---

#### **V3.60(LL.3)C0 (5/3/2006)**

2. Change temperature  
MAC: 75 ~ -10, CPU: 65 ~ -10, PHY: 75 ~ -10

#### **V3.60(LL.2)C0 (1/2/2006)**

16. Restore config with IP address fail because out-of-band and inband exchange IP addresses.
17. Remove "time" and "time date" in backup configuration
18. Timesync config can't restore
19. Enable OSPF , send over 8K routing paths, system hang.
20. DUT trap VRRP packets into CPU when VRRP disable
21. Create more than 6 static routing entries, the switch will hang
22. The Vlan status does not recover to original status after change trunking group to none.
23. Create VLAN ID 000001 via CLI found VLAN ID 0 is be created
24. Enable IGMPsnooping, One port leave message effect on another received port losing multicast packets, it should not effect on another received port.
25. revise ospf interface web page
26. Can't use Cluster Management function with Telnet or SSH client to re-command members.
27. In filtering function set Filter Destination after SMB send unknow unicast CLI will show "sal\_dma\_alloc out of memory. size 9232 packet\_alloc. "
28. DUT 's RIPv2 multicast function did not work
29. Memory leak bug on stunnel. It will run out of memory when scan https many times.
30. When fiber set to speed 1000, auto negotiation should be turn off.

#### **V3.60(LL.1)C0 (6/27/2005)**

#### **V3.60(LL.0)C0 (3/24/2005)**

First Public version

# ZyXEL GS-4024 V3.60(LL.2)C0

## Release Note/Manual Supplement

---

**Date:** Jan. 2, 2006

This document describes the features in the GS-4024 product for its 3.60(LL.2)C0 release.

### ***Support Platforms:***

---

ZyXEL GS-4024 V3.60(LL.2)C0 supports models: Dimension GS-4024

### ***Version:***

---

ZyNOS version: V3.60(LL.2) | 01/02/2006  
bootbase version: V3.0 | 04/06/2005 18:05:30

### ***Default Bootbase Setting:***

---

ZyNOS Version	V3.60(LL.2)   01/02/2006 10:34:36
Bootbase Version	V3.0   04/06/2005 18:05:30
Vendor Name	ZyXEL Communications Corp.
Product Model	GS-4024
ZyNOS Code Model	GS-4024
HTP Code Model	Unknown
ZyNOS ROM address	50080000
System Type	10
MAC Address	001349000001
Default Country Code	FF
Boot Module Debug Flag	00
RomFile Version	5A
RomFile Checksum	67ef
ZyNOS Checksum	7711
SNMP MIB level & OID	060102030405060708091011121314151617181920
Main Feature Bits	C0
Other Feature Bits	
DB 00 00 00 00 00 00 00 00 00-00 00 00 00 00 00 00 00 00 00 00 00 00 00 00 00 00-00 4113 00 00 00	

### ***Enhanced Features:***

- 
1. Multicast
  2. MVR
  3. IGMP Filtering
  4. CIR & PIR
  5. Mac Freeze
  6. Intrusion Lock
  7. MIB

### ***Bug Fix:***

---

1. Restore config with IP address fail because out-of-band and inband exchange IP addresses.
2. Remove "time" and "time date" in backup configuration
3. Timesync config can't restore
4. Enable OSPF , send over 8K routing paths, system hang.
5. DUT trap VRRP packets into CPU when VRRP disable
6. Create more than 6 static routing entries, the switch will hang
7. The Vlan status does not recover to original status after change trunking group to none.
8. Create VLAN ID 000001 via CLI found VLAN ID 0 is be created
9. Enable IGMPsnooping, One port leave message effect on another received port losing multicast packets, it should not effect on another received port.
10. revise ospf interface web page
11. Can't use Cluster Management function with Telnet or SSH client to re-command members.
12. In filtering function set Filter Destination after SMB send unknow unicast CLI will show "sal\_dma\_alloc out of memory. size 9232 packet\_alloc. "
13. DUT 's RIPV2 multicast function did not work
14. Memory leak bug on stunnel. It will run out of memory when scan https many times.
15. When fiber set to speed 1000, auto negotiation should be turn off.

### ***Known Issue:***

---

7. In some circumstances, packets may route to blocking port of the other device when use Spanning Tree Protocol for redundant purpose between two devices. Recommend using Link Aggregation instead.
8. For many to one test , packet loss 3 % on one receiving port.
9. Discard destination MAC on filter rule , but the same source MAC packet still be filtered.
10. Can't support ip port move.
11. Flow control can not go across unit.

### ***Limitation of Settings:***

---

3. VLAN 1Q static entry 256
4. Static MAC forwarding entry 256
5. MAC filtering entry 256
6. Cluster member 24
7. IP routing domain 64
8. IGMP Filtering entry 256
9. MVR entry 256
10. Vrrp entry 14
11. OSPF area 4

### ***Change History:***

---

1. Restore config with IP address fail because out-of-band and inband exchange IP addresses.
2. Remove "time" and "time date" in backup configuration
31. Timesync config can't restore
32. Enable OSPF , send over 8K routing paths, system hang.
33. DUT trap VRRP packets into CPU when VRRP disable
34. Create more than 6 static routing entries, the switch will hang
35. The Vlan status does not recover to original status after change trunking group to none.
36. Create VLAN ID 000001 via CLI found VLAN ID 0 is be created
37. Enable IGMPsnooping, One port leave message effect on another received port losing multicast packets, it should not effect on another received port.

- 38. revise ospf interface web page
- 39. Can't use Cluster Management function with Telnet or SSH client to re-command members.
- 40. In filtering function set Filter Destination after SMB send unknow unicast CLI will show "sal\_dma\_alloc out of memory. size 9232 packet\_alloc. "
- 41. DUT 's RIPv2 multicast function did not work
- 42. Memory leak bug on stunnel. It will run out of memory when scan https many times.
- 43. When fiber set to speed 1000, auto negotiation should be turn off.



# ZyXEL GS-4024 V3.60(LL.1)C0

## Release Note/Manual Supplement

**Date: June 27, 2005**

This document describes the features in the GS-4024 product for its 3.60(LL.1) release.

### **Support Platforms:**

ZyXEL GS-4024 V3.60(LL.1) supports models: Dimension GS-4024

### **Version:**

ZyNOS version: V3.60(LL.1) | 06/24/2005

bootbase version: V3.0 | 04/06/2005 18:05:30

### **Default Bootbase Setting:**

ZyNOS Version	V3.60(LL.1)   06/24/2005
Bootbase Version	V3.0   04/06/2005 18:05:30
Vendor Name	ZyXEL Communications Corp.
Product Model	GS-4024
ZyNOS Code Model	GS-4024
HTP Code Model	Unknown
ZyNOS ROM address	50080000
System Type	10
MAC Address	001349000001
Default Country Code	FF
Boot Module Debug Flag	00
RomFile Version	DF
RomFile Checksum	7bc3
ZyNOS Checksum	f777
SNMP MIB level & OID	060102030405060708091011121314151617181920
Main Feature Bits	C0
Other Feature Bits	
DB 00 00 00 00 00 00 00 00-00 00 00 00 00 00 00 00 00 00 00 00 00 00 00 00-00 4113 00 00 00	

### **Known Issue:**

1. When restore configuration, the default VLAN and the default IP address will be implicitly created.
2. In some circumstances, packets may route to blocking port of the other device when use Spanning Tree Protocol for redundant purpose between two devices. Recommend using Link Aggregation instead.

# ZyXEL GS-4024 V3.60(LL.0)C0

## Release Note/Manual Supplement

**Date:** Mar 24, 2005

This document describes the features in the GS-4024 product for its 3.60(LL.0) release.

### **Support Platforms:**

ZyXEL GS-4024 V3.60(LL.0) supports models: Dimension GS-4024

### **Version:**

ZyNOS version: V3.60(LL.0) | 03/24/2005 13:49:28

bootbase version: V2.0 | 01/18/2005 00:04:33

### **Default Bootbase Setting:**

ZyNOS Version	V3.60(LL.0)   03/24/2005 13:49:28
Bootbase Version	V2.0   01/18/2005 00:04:33
Vendor Name	ZyXEL Communications Corp.
Product Model	GS-4024
ZyNOS Code Model	GS-4024
HTP Code Model	Unknown
ZyNOS ROM address	50080000
System Type	10
MAC Address	00A0C5012345
Default Country Code	FF
Boot Module Debug Flag	00
RomFile Version	F8
RomFile Checksum	1236
ZyNOS Checksum	147c
SNMP MIB level & OID	060102030405060708091011121314151617181920
Main Feature Bits	C0
Other Feature Bits	
DB 00 00 00 00 00 00 00 00 00-00 00 00 00 00 00 00 00	
00 00 00 00 00 00 00 00 00-00 4113 00 00 00	

### **Features:**

Features:

1. 24 ports Auto MDI/MDI-X 100/1000Mbps compliant with IEEE802.3u/x/ad
2. 4 ports Mini GBIC 1000Mbps compliant with IEEE802.3x/ab
3. 16K layer2 MAC addresses table
4. 8K IP address table
5. Support 1MB on-chip packet buffer.
6. 802.1D transparent bridging
7. Port-based VLAN
8. IEEE 802.1Q tag-based VLAN

9. IGMP snooping
10. MAC filtering
11. Management through console, telnet, SNMP or web management
12. Firmware upgrade by FTP
13. Configuration saving and retrieving
14. Overheat detection
15. LED indications for link status
16. External power backup for internal power module failure
17. 9K jumbo frame
18. Filtering/Mirroring by L2/L3/L4 rules
19. Bandwidth control by L2/L3/L4 rules
20. Egress traffic shaping per port
21. Private VLAN for port isolation
22. SSH v1 and v2
23. SSL

---

**Known Issue:**

1. When restore configuration, the default VLAN and the default IP address will be implicitly created.
2. In some circumstances, packets may route to blocking port of the other device when use Spanning Tree Protocol for redundant purpose between two devices. Recommend using Link Aggregation instead.

---

**Change History:**

V3.60(LL.0)C0 (03/24/2005) is First Public version

---

**Firmware Upgrade:**

The GS-4024 uses FTP to upgrade firmware in run-time through its built-in FTP server. You can use any FTP client (for example, [ftp.exe](#) in Windows) to upgrade GS-4024. The upgrade procedure is as follows:

**Upgrade GS-4024 FW:**

```
C:\> ftp <GS-4024 IP address>
User : admin
Password: 1234
230 Logged in
ftp> put 360LL0C0.bin ras
ftp> bye
```

Where

- User name : the management user name, admin by default
- Password : the management password, 1234 by default
- 360LL0C0.bin : the name of firmware file you want to upgrade
- ras : the internal firmware name in GS-4024

## ***Configuration Upgrade:***

---

The GS-4024 uses FTP to upgrade firmware in run-time through its built-in FTP server. You can use any FTP client (for example, [ftp.exe](#) in Windows) to upgrade GS-4024. The upgrade procedure is as follows:

### **Upgrade GS-4024 FW:**

```
C:\> ftp <GS-4024 IP address>
User : admin
Password: 1234
230 Logged in
ftp> put 360LL0C0.rom rom-0
ftp> bye
```

Where

- User name : the management user name, admin by default
- Password : the management password, 1234 by default
- 360LL0C0.rom : the name of configuration file you want to upgrade
- rom-0 : the internal configuration name in GS-4024